MAZDA TRANSPONDER BYPASS

MPV 2000 - 04
MIATA 2001 - 04

TECHNICAL SUPPORT :
TEL : 514-255-2720
FAX: 514-255-1367
www.ifar.ca

Programming sequence:

Once the connections are made.
Locate and press the programming switch while inserting the harness connector into the MAZDA-DATA module.
The LED status indicator will turn ON to indicate the programming mode.
Release programming button. Start the vehicle with a functionnal key.
When the LED flash the module is programmed.

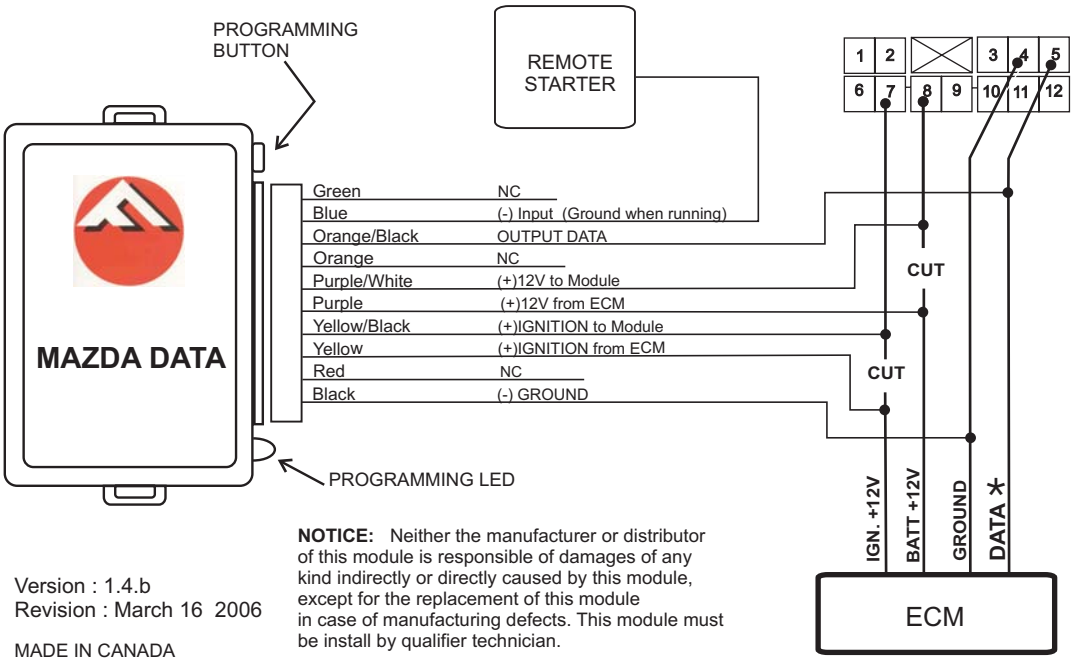

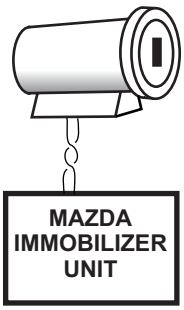

Locate under the dash, right side of steering weel colone

VEHICLE	
MODELS	**YEARS**
MPV	2000 - 2003
MPV	2004
MIATA	2001 - 2004

WIRE COULEURS

	# pin conn.	MPV 00-03	MPV 04	MIATA 01-04
Black/Orange(ground)	4	X	X	X
Blue/White (data)	5		X	
Red/Black (data)	5			X
Blue/Black (data)	5	X		
Black/White (ignition)	7	X	X	X
Blue/Red (Batterie)	8	X	X	X

NOTICE: Neither the manufacturer or distributor of this module is responsible of damages of any kind indirectly or directly caused by this module, except for the replacement of this module in case of manufacturing defects. This module must be install by qualifier technician.

Version : 1.4.b
Revision : March 16 2006

MADE IN CANADA

MAZDA TRANSPONDER BYPASS

MPV 2000 - 04
MIATA 2001 - 04

TECHNICAL SUPPORT :
TEL : 514-255-2720
FAX: 514-255-1367
www.ifar.ca

Programming sequence:

Once the connections are made.
Locate and press the programming switch while inserting the harness connector into the MAZDA-DATA module.
The LED status indicator will turn ON to indicate the programming mode.
Release programming button. Start the vehicle with a functionnal key.
When the LED flash the module is programmed.

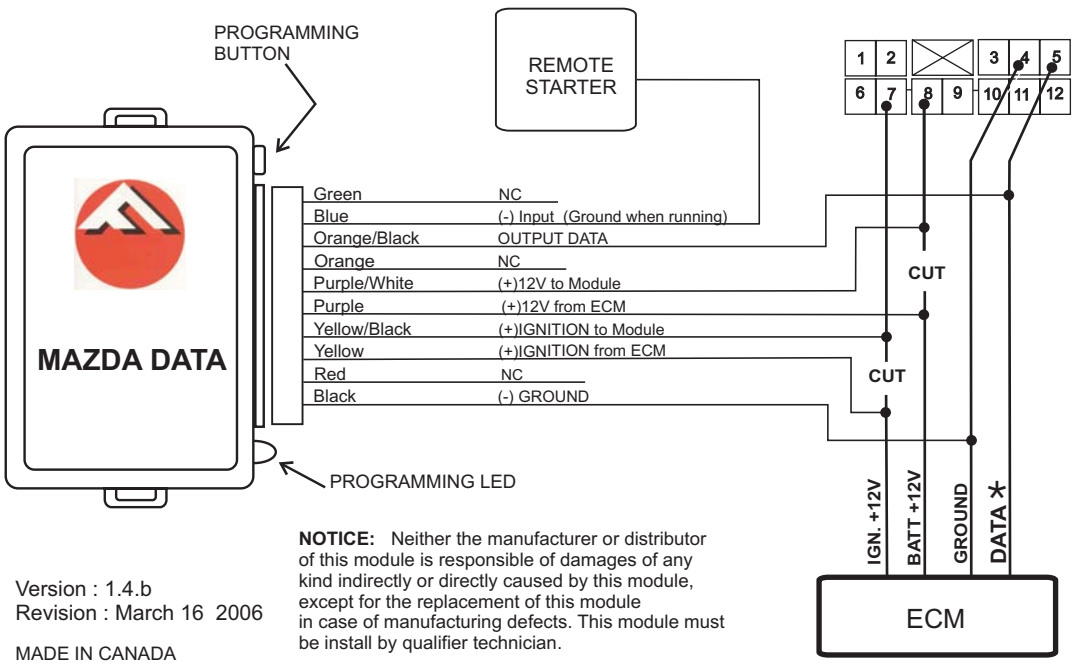

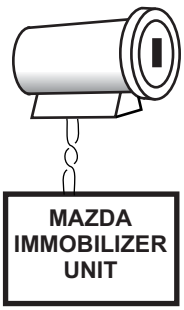

Locate under the dash, right side of steering weel colone

VEHICLE	
MODELS	**YEARS**
MPV	2000 - 2003
MPV	2004
MIATA	2001 - 2004

WIRE COULEURS

	# pin conn.	MPV 00-03	MPV 04	MIATA 01-04
Black/Orange(ground)	4	X	X	X
Blue/White (data)	5		X	
Red/Black (data)	5			X
Blue/Black (data)	5	X		
Black/White (ignition)	7	X	X	X
Blue/Red (Batterie)	8	X	X	X

NOTICE: Neither the manufacturer or distributor of this module is responsible of damages of any kind indirectly or directly caused by this module, except for the replacement of this module in case of manufacturing defects. This module must be install by qualifier technician.

Version : 1.4.b
Revision : March 16 2006

MADE IN CANADA